


XBA-41X Option Switch Settings

Supported bill

INR 5, 10, 20, 50, 100, 200, 500 **7bills.**
USD 1, 5, 10, 20, 50, 100 **6bills.**
EUR 5, 10, 20, 50, 100, 200 **6bills.**
GBP 5, 10, 20 **3bills.**

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reserved	ON							
★	Reserved	OFF							
★	Reserved		ON						
★	Reserved		OFF						
★	Reserved			ON					
★	Reserved			OFF					
★	Reserved				ON				
★	Reserved				OFF				
★	Reserved					ON			
★	Reserved					OFF			
★	Disable Bill Reject 4 Times BA Stop By 30 Sec						ON		
★	Enable Bill Reject 4 Times BA Stop By 30 Sec						OFF		
★	Stack Banknote when Power-up							ON	
★	Reject Banknote when Power-up							OFF	
★	Reserved								ON
★	Reserved								OFF

This dip switch is located at the side of XBA.

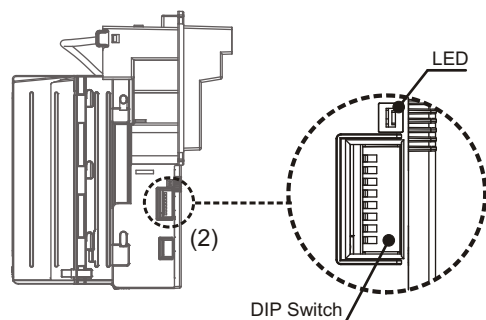


XBA-41X (ICT108U)

	FUNCTION	SW1	SW2	SW3	SW4	SW5	SW6	SW7	SW8
★	Reserved	ON							
★	Reserved	OFF							
★	Reserved		ON						
★	Reserved		OFF						
★	Reserved			ON					
★	Reserved			OFF					
★	Reserved				ON				
★	Reserved				OFF				
★	Reserved					ON			
★	Reserved					OFF			
★	ICT108U						ON		
★	Reserved								OFF

★ Manufacture setting

Note : 1.No sleep function.
2.Calibrate card.

This dip switch is located on the CPU board, remove the CPU board cover first.

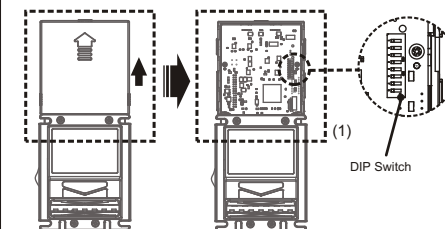

Currency Assign Data

Interface Bill value	ICT108U Bill value	Interface Bill value	ICT108U Bill value	Interface Bill value	ICT108U Bill value	Interface Bill value	ICT108U Bill value
BV1	INR 5	BV8	USD 1	BV14	EUR 5	BV20	GBP 5
BV2	INR 10	BV9	USD 5	BV15	EUR 10	BV21	GBP 10
BV3	INR 20	BV10	USD 10	BV16	EUR 20	BV22	GBP 20
BV4	INR 50	BV11	USD 20	BV17	EUR 50		
BV5	INR 100	BV12	USD 50	BV18	EUR 100		
BV6	INR 200	BV13	USD 100	BV19	EUR 200		
BV7	INR 500						